

To configure the EN6001 to work with Soft Touch:

1. From the Main Status page press **F** (Function)
2. Arrow Down to highlight **ABOUT**
3. Hold the + button and press **ENTER**
4. Arrow up / down until **CONFIG** is highlighted
5. Press **ENTER**
6. Arrow Down to highlight **SECOND STAGE**
7. Press + or – until **BEFORE SQZ** is displayed
8. Press **ENTER**
9. Press **ESC** until the Main Status page is displayed
10. From the Main Status page press **F** (Function)
11. Arrow Down to highlight **ABOUT**
12. Hold the + button and press **ENTER**
13. Arrow Up / Down until **I/O MAP** is highlighted
14. Press **ENTER**
15. Arrow to highlight **I/O FUNCTION**
16. Press **ENTER**
17. Select a Programmable Input 1 or 3 below
 - a. Arrow to highlight **PI1**
 - b. Press + until **2nd Stage** is displayed
 - c. Press **ENTER**
 - d. --- OR ---
 - e. Arrow to highlight **PI3**
 - f. Press + until **2nd Stage** is displayed
 - g. Press **ENTER**
18. Press **ESC**
19. Arrow to **PI Source**
20. Press **ENTER**
21. Select PI1 or PI3 below
 - a. Arrow to **PI1**
 - b. Press + until **LOCAL** is displayed
 - c. Press **ENTER**
 - d. --- OR ---
 - e. Arrow to **PI3**
 - f. Press + until **LOCAL** is displayed
 - g. Press **ENTER**
22. Press **ESC**
23. Arrow to **SINGAL SOURCE**
24. Press **ENTER**
25. Arrow until **2nd STAGE** is highlighted
26. Press + until **PI** is displayed
27. Press **ENTER**
28. Press **ESC** until the Main Status screen is displayed.

Distributed by:
Production Engineering
888-654-WELD (9353)
sales@productionengineering.com
www.resistanceweldsupplies.com